
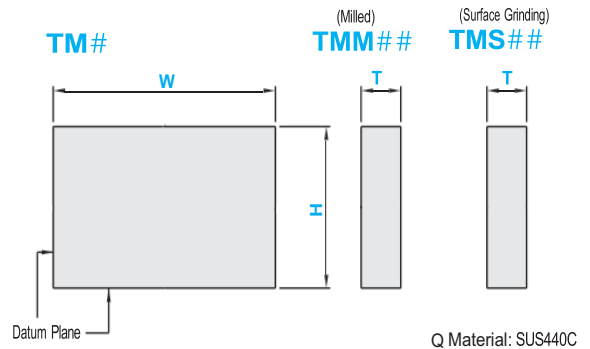


# Plates - SUS440C

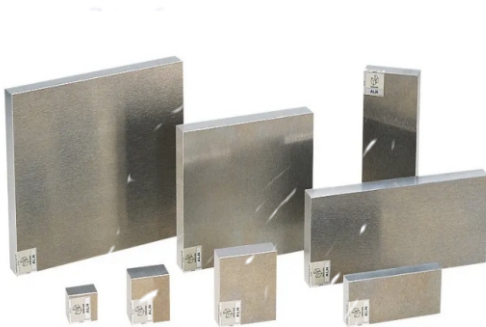

| Part Number |                            |                             |                           | 0.5mm Increment |        |      |
|-------------|----------------------------|-----------------------------|---------------------------|-----------------|--------|------|
| Type        | Upper-Lower Surface Finish | ① Plate Thickness Tolerance | ② W,H Dimension Tolerance | W               | H      | T    |
|             |                            |                             |                           | W≥H             |        |      |
| TM          | M (Milled)                 | K<br>L<br>M<br>N            | K<br>L<br>M<br>N          | 20~500          | 20~300 | 5~40 |
|             | S (Surface Grinding)       |                             |                           | 20~200          | 20~200 |      |

Ⓜ Some sizes cannot be machined. See the price list for details.

Ⓢ Please choose the size such that  $W \geq H$  for milled and  $W < H \times 3$  for surface-ground products.

## ① Plate Thickness Tolerance

| Upper-Lower Surface Finish | K         | L      | M     | N      |
|----------------------------|-----------|--------|-------|--------|
| M (Milled)                 | +0.1~+0.5 | 0~+0.4 | ±0.5  | -0.5~0 |
| S (Surface Grinding)       | +0.1~+0.3 | 0~+0.1 | ±0.05 | -0.1~0 |

## ② W,H Dimension Tolerance

| Upper-Lower Surface Finish | W,H Dimension   | K         | L      | M     | N      |
|----------------------------|-----------------|-----------|--------|-------|--------|
| M (Milled)                 | 250mm or Less   | +0.1~+0.5 | 0~+0.4 | ±0.5  | -0.5~0 |
| S (Surface Grinding)       | 250.5mm or More | +0.1~+0.6 | 0~+0.5 | ±0.25 | -0.5~0 |

| Part Number |                            |                           |                          |   |                |
|-------------|----------------------------|---------------------------|--------------------------|---|----------------|
| Type        | Upper Lower Surface Finish | Plate Thickness Tolerance | W, H Dimension Tolerance | - | W - H - T      |
| TM          | S                          | K                         | K                        | - | 300 - 150 - 30 |

# How to choose

| Part Number | W          | H         | T | 5 | 5.5~6 | 6.5~8 | 8.5~10 | 10.5~12 | 12.5~15 | 15.5~25 | 25.5~35 | 35.5~40 |
|-------------|------------|-----------|---|---|-------|-------|--------|---------|---------|---------|---------|---------|
| TMM# #      | 20 ~ 50    | 20~25     |   |   |       |       |        |         |         |         |         |         |
|             | 50.5~ 75   |           |   |   |       |       |        |         |         |         |         |         |
|             | 75.5~ 100  |           |   |   |       |       |        |         |         |         |         |         |
|             | 100.5~ 250 |           | - | - |       |       |        |         |         |         |         |         |
|             | 250.5~ 350 | 25.5~40   | - | - | -     |       |        |         |         |         |         |         |
|             | 25.5~ 50   |           |   |   |       |       |        |         |         |         |         |         |
|             | 50.5~ 75   |           |   |   |       |       |        |         |         |         |         |         |
|             | 75.5~ 100  |           |   |   |       |       |        |         |         |         |         |         |
|             | 100.5~ 200 | 40.5~60   | - | - |       |       |        |         |         |         |         |         |
|             | 200.5~ 500 |           | - | - | -     |       |        |         |         |         |         |         |
|             | 40.5~ 50   |           |   |   |       |       |        |         |         |         |         |         |
|             | 50.5~ 75   |           |   |   |       |       |        |         |         |         |         |         |
|             | 75.5~ 100  | 60.5~80   | - | - |       |       |        |         |         |         |         |         |
|             | 100.5~ 200 |           | - | - | -     |       |        |         |         |         |         |         |
|             | 200.5~ 500 |           | - | - | -     |       |        |         |         |         |         |         |
|             | 80.5~ 100  |           | - | - | -     |       |        |         |         |         |         |         |
|             | 100.5~ 200 | 80.5~100  | - | - | -     |       |        |         |         |         |         |         |
|             | 200.5~ 500 |           | - | - | -     |       |        |         |         |         |         |         |
|             | 100.5~ 125 |           | - | - | -     |       |        |         |         |         |         |         |
|             | 125.5~ 200 |           | - | - | -     |       |        |         |         |         |         |         |
|             | 200.5~ 500 | 100.5~125 | - | - | -     |       |        |         |         |         |         |         |
|             | 125.5~ 200 |           | - | - | -     |       |        |         |         |         |         |         |
|             | 200.5~ 500 |           | - | - | -     |       |        |         |         |         |         |         |
|             | 150.5~ 200 |           | - | - | -     |       |        |         |         |         |         |         |
|             | 200.5~ 500 | 125.5~150 | - | - | -     |       |        |         |         |         |         |         |
|             | 150.5~ 200 |           | - | - | -     |       |        |         |         |         |         |         |
|             | 200.5~ 500 |           | - | - | -     |       |        |         |         |         |         |         |
|             | 160.5~ 200 |           | - | - | -     |       |        |         |         |         |         |         |
|             | 200.5~ 500 | 150.5~160 | - | - | -     |       |        |         |         |         |         |         |
|             | 160.5~ 200 |           | - | - | -     |       |        |         |         |         |         |         |
|             | 200.5~ 500 |           | - | - | -     |       |        |         |         |         |         |         |
|             | 200.5~ 500 |           | - | - | -     |       |        |         |         |         |         |         |

| Part Number | W          | H         | T | 5 | 5.5~6 | 6.5~8 | 8.5~10 | 10.5~12 | 12.5~15 | 15.5~25 | 25.5~35 | 35.5~40 |
|-------------|------------|-----------|---|---|-------|-------|--------|---------|---------|---------|---------|---------|
| TMS# #      | 20 ~ 50    | 20~25     |   |   |       |       |        |         |         |         |         |         |
|             | 50.5~ 75   |           |   |   |       |       |        |         |         |         |         |         |
|             | 75.5~ 100  |           |   |   |       |       |        |         |         |         |         |         |
|             | 100.5~ 200 |           | - | - |       |       |        |         |         |         |         |         |
|             | 25.5~ 50   | 25.5~40   |   |   |       |       |        |         |         |         |         |         |
|             | 50.5~ 75   |           |   |   |       |       |        |         |         |         |         |         |
|             | 75.5~ 100  |           |   |   |       |       |        |         |         |         |         |         |
|             | 100.5~ 200 |           | - | - |       |       |        |         |         |         |         |         |
|             | 40.5~ 50   | 40.5~60   |   |   |       |       |        |         |         |         |         |         |
|             | 50.5~ 75   |           |   |   |       |       |        |         |         |         |         |         |
|             | 75.5~ 100  |           |   |   |       |       |        |         |         |         |         |         |
|             | 100.5~ 200 |           | - | - |       |       |        |         |         |         |         |         |
|             | 60.5~ 75   | 60.5~80   |   |   |       |       |        |         |         |         |         |         |
|             | 75.5~ 100  |           |   |   |       |       |        |         |         |         |         |         |
|             | 100.5~ 200 |           | - | - |       |       |        |         |         |         |         |         |
|             | 80.5~ 100  |           | - | - | -     |       |        |         |         |         |         |         |
|             | 100.5~ 200 | 80.5~100  | - | - | -     |       |        |         |         |         |         |         |
|             | 100.5~ 200 |           | - | - | -     |       |        |         |         |         |         |         |
|             | 125.5~ 200 |           | - | - | -     |       |        |         |         |         |         |         |
|             | 150.5~ 200 |           | - | - | -     |       |        |         |         |         |         |         |
|             | 160.5~ 200 | 100.5~125 | - | - | -     |       |        |         |         |         |         |         |
|             | 160.5~ 200 |           | - | - | -     |       |        |         |         |         |         |         |
|             | 160.5~ 200 |           | - | - | -     |       |        |         |         |         |         |         |
|             | 160.5~ 200 |           | - | - | -     |       |        |         |         |         |         |         |
|             | 160.5~ 200 | 125.5~150 | - | - | -     |       |        |         |         |         |         |         |
|             | 160.5~ 200 |           | - | - | -     |       |        |         |         |         |         |         |
|             | 160.5~ 200 |           | - | - | -     |       |        |         |         |         |         |         |
|             | 160.5~ 200 |           | - | - | -     |       |        |         |         |         |         |         |
|             | 160.5~ 200 | 150.5~160 | - | - | -     |       |        |         |         |         |         |         |
|             | 160.5~ 200 |           | - | - | -     |       |        |         |         |         |         |         |
|             | 160.5~ 200 |           | - | - | -     |       |        |         |         |         |         |         |
|             | 160.5~ 200 |           | - | - | -     |       |        |         |         |         |         |         |
|             | 160.5~ 200 | 160.5~300 | - | - | -     |       |        |         |         |         |         |         |
|             | 160.5~ 200 |           | - | - | -     |       |        |         |         |         |         |         |
|             | 160.5~ 200 |           | - | - | -     |       |        |         |         |         |         |         |
|             | 160.5~ 200 |           | - | - | -     |       |        |         |         |         |         |         |